

Displaced stonework. Wall unstable and leaning and in danger of imminent collapse. Carefully record and dismantle as C41/140 and C41/121. Rebuild as C41/125

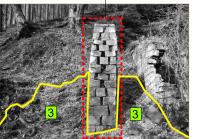

WL08.01 East elevation, displaced stonework

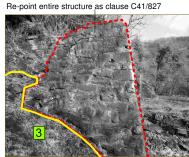

Rake out cementitious pointing as clause C41/815 Dismantle as C41/121. Rebuild as clause C41/125

WL08.02 South elevation



WL08.04 North elevation




WL08.01 and 4 Viewed from north-east

Unstable and leaning leat wall in danger


of imminent collapse
Carefully record all stonework as clause

510


C41/140 and dismantle complete as C41/121 Rebuild as C41/125

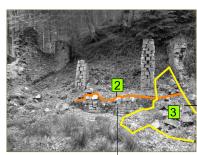

WL08.01 East elevation

 

for possible reuse

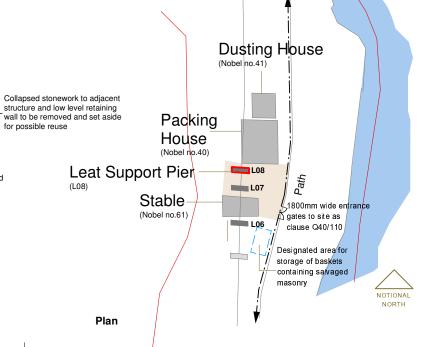

Structural cracks

Section of collapsed wall to be reformed during full re-contraction work of leat using salvaged collapsed stonework as C41/125



WL08.01 East elevation - Displaced stonework

WL08.01 East elevation - Excessive open joints



WL08.02 South elevation - Structural failure



WL08.02 South elevation - Cementitious pointing






WL08.02 South elevation - Structural cracking




WL08.04 North elevation - Structural cracking

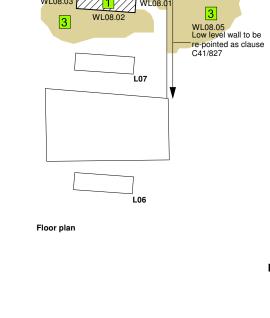


Location

620 930 1010 1220 1390 1590 1760 1950 2166 2350 8 580 2030 WL08.02 South elevation WL08.01 East elevation

All vegetation and roots to be treated as clause C41/130 prior to dismantling wall to ensure no active roots remain

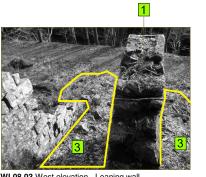

WL08.03 West elevation - Leaning wall

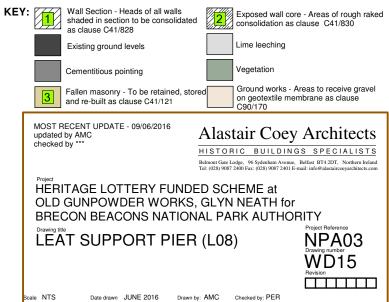



WL08.02 South elevation - Structural collapse at

