


Threaded purlin joint at truss

0 centimetres 50

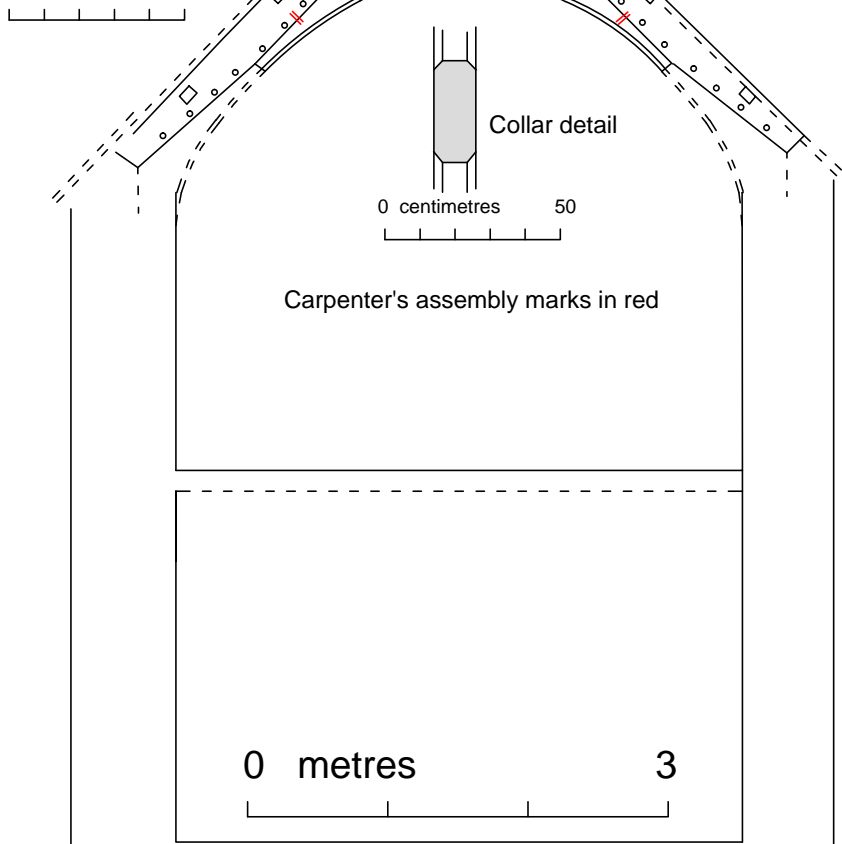


Collar detail

0 centimetres 50

Carpenter's assembly marks in red

0 metres 3

Cross-section of chapel roof

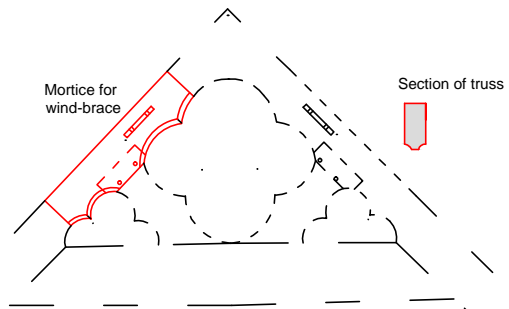

Mortise for wind-brace

Section of truss

Hall roof truss reconstruction from re-used lintel (shown in red)

0 metres 3

Hall roof truss


Court Henri

Llangathen

NGR SN55662256

NPRN 17246

Recorded Geoff Ward, 18/ 12/ 2014.

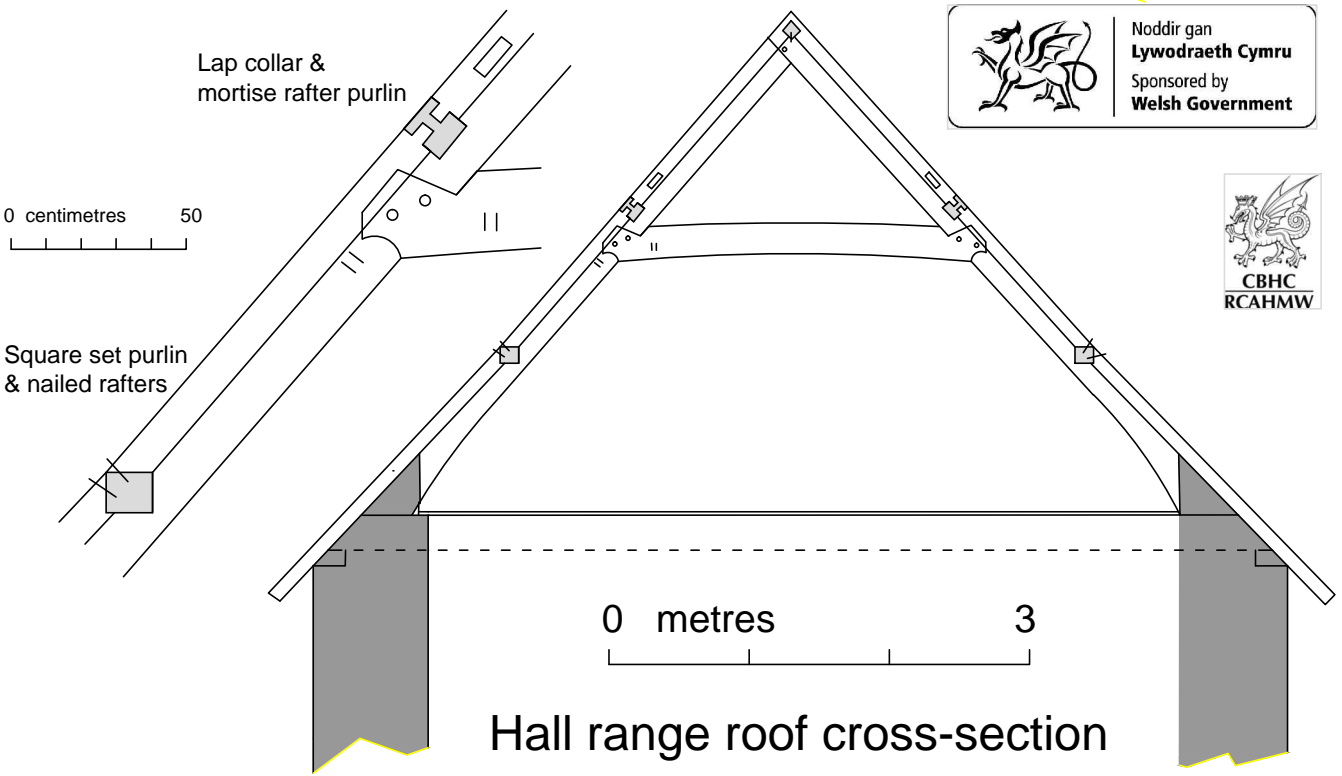

Lap collar & mortise rafter purlin

0 centimetres 50

Square set purlin & nailed rafters

0 metres 3

Hall range roof cross-section

